

RESULTS OF SOME COMPRESSION TESTS OF STRUCTURAL STEEL ANGLES.

By A. H. Stang and L. R. Strickenberg.

ABSTRACT.

This article presents the results of compression tests of 170 structural angles, made at the Pittsburgh branch, Bureau of Standards. The object of the tests was to determine the ultimate compressive strength of angles fastened at the ends in such ways as would closely correspond to their connections in the construction of transmission towers. There was also tested a series of angles with square ends. An end fixation factor was found to represent satisfactorily the effect of different types of end connections. Using this fixation factor, the average values for large slenderness ratios were well represented by Euler's formula. The results obtained from shorter columns agreed with the experimental and theoretical results of Kármán. The effect of eccentric loading was most marked at the slenderness ratios indicated by Kármán's theory.

CONTENTS.

	Page.
I. Introduction	651
II. Methods of testing	652
III. Results and discussion of tests	671
IV. Conclusions	677

I. INTRODUCTION.

Compression tests of 170 standard rolled structural steel angles were made at the Pittsburgh laboratory of the Bureau of Standards during the spring of 1917. The specimens tested were all furnished by the tower department of the American Bridge Co., which cooperated in planning the investigation and in carrying out the tests. As the angles were intended for legs and lattice members in electrical transmission tower construction, the greater number were tested with bolted ends, the bolting imitating the riveting used in the construction of the towers. For comparison a number of angles were also tested with flat ends.

II. METHOD OF TESTING.

The specimens were all tested in a 600,000-pound Olsen testing machine. (Fig. 1 shows a general view of the testing machine with an angle under load.) In order to determine the deformation that took place in the angle as the load was applied, a special compressometer was used which was so located as to measure the shortening of the centroidal axis of the specimen. A view of the compressometer attached to a test specimen is shown in Figure 2.

The angles with square ends, having no bolts, were mounted directly between the base and the straining head of the testing machine. In order to test the bolted specimens, special fixtures of structural material were bolted to the base and straining head of the machine and the specimens bolted to these, as shown in Figure 2, a view of the connection used for two bolts in one leg of the angle. A specimen with ends folded is shown in Fig. 3.

The dimensions of the angles are shown in Tables 1 to 7, inclusive, and in Figures 4 to 15 accompanying them. The physical and chemical properties of the material in the angles, obtained incompletely from the mill test reports, are given in Table 8.

TABLE 1.—Results of Compression Tests on Angles with Square Ends, No Bolts.




Fig. 4.

Specimen No.	Length L.	Size angle.	Maximum load (lbs./in. ²) for slenderness ratio 1/r =						
			50	100	150	200	250	300	350
A1.....	Ft. in.	Inches.							
A1.....	5 0	3 by 3 by $\frac{1}{8}$		40,000					
A2.....	10 0	3 by 3 by $\frac{1}{8}$				26,800			
A3.....	15 0	3 by 3 by $\frac{3}{8}$						10,750	
A4.....	2 5 $\frac{1}{2}$	3 by 3 by $\frac{1}{4}$	37,000						
A5.....	4 11	3 by 3 by $\frac{1}{4}$		36,000					
A6.....	7 4 $\frac{1}{2}$	3 by 3 by $\frac{1}{4}$			32,500				
A7.....	9 10	3 by 3 by $\frac{1}{4}$				25,000			
A8.....	12 3 $\frac{1}{2}$	3 by 3 by $\frac{1}{4}$					16,580		
A9.....	14 9	3 by 3 by $\frac{1}{4}$						10,750	
A10.....	17 2 $\frac{1}{2}$	3 by 3 by $\frac{1}{4}$							9,000
A11.....	5 9	3 $\frac{1}{2}$ by 3 $\frac{1}{2}$ by $\frac{1}{4}$		33,000					
A12.....	11 6	3 $\frac{1}{2}$ by 3 $\frac{1}{2}$ by $\frac{1}{4}$				22,500			
A13.....	17 3	3 $\frac{1}{2}$ by 3 $\frac{1}{2}$ by $\frac{1}{4}$						12,660	
Average.....			37,000	36,300	32,500	24,800	16,580	11,390	9,000

Technologic Papers of the Bureau of Standards, Vol. 16.

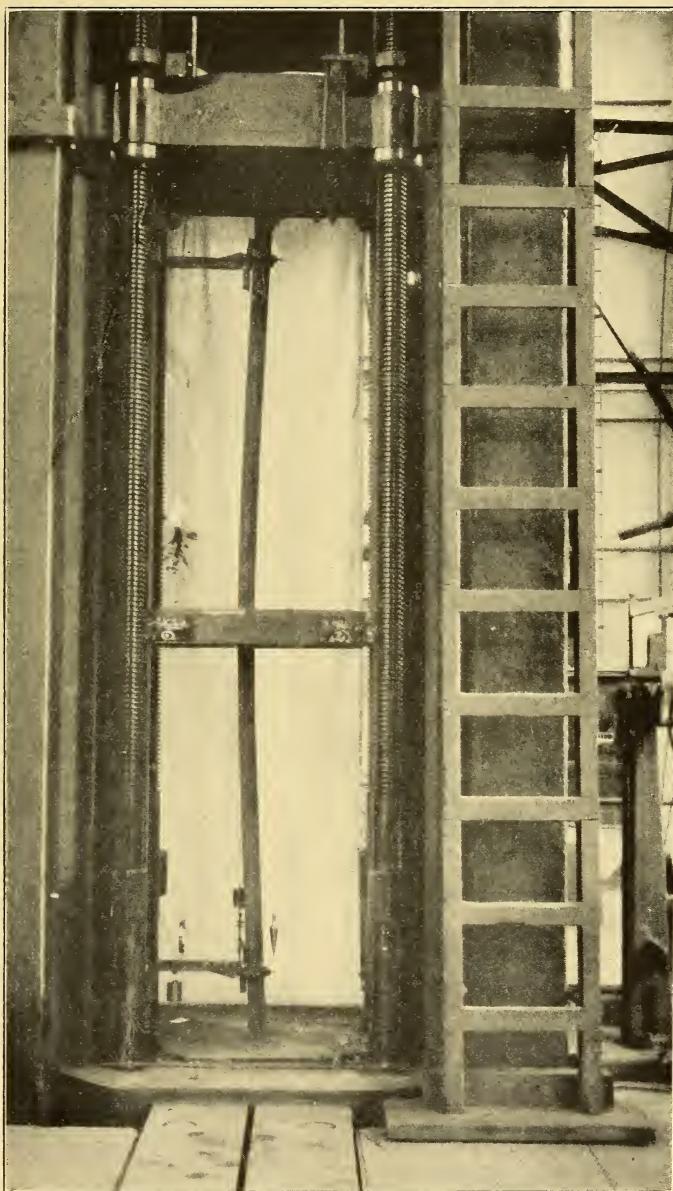


FIG. 1.—View of the testing machine with an angle under load.

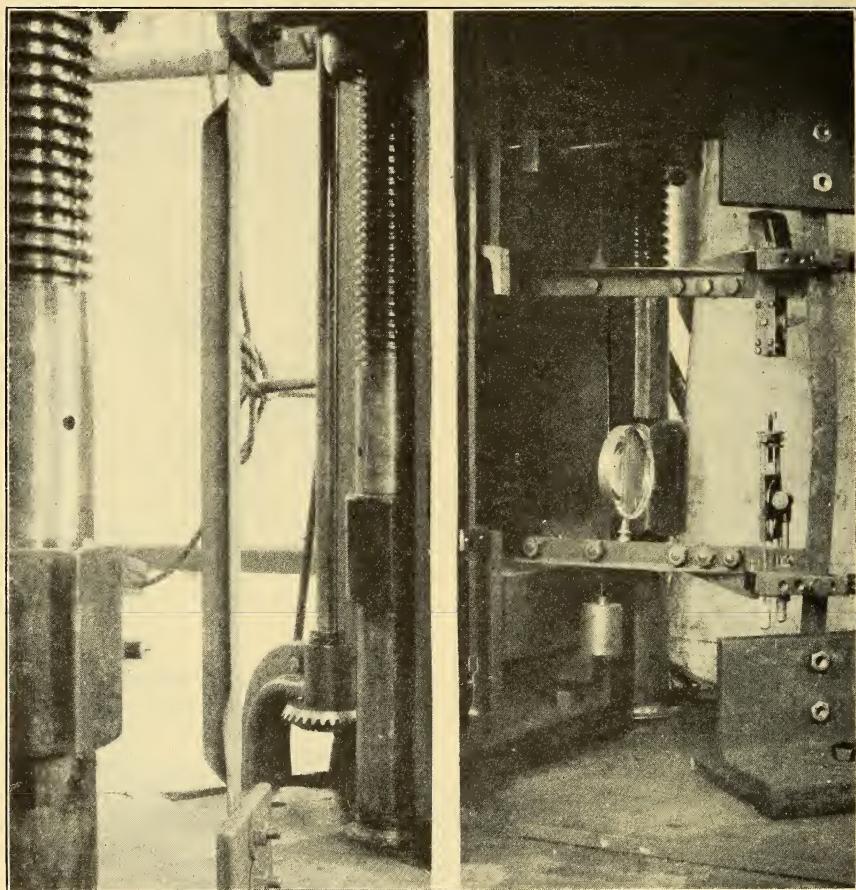


FIG. 3.—*An angle with ends folded, in the testing machine.*

FIG. 2.—*View of compressometer and connections used for fastening a test specimen to the testing machine, two bolts in one leg.*

TABLE 2.—Results of Compression Tests on Angles with One Bolt Connection, Plain Ends.




Fig. 5.

Specimen No.	Length L.	Distance M.	Size angles.	Distance N.	Diameter of holes.	Maximum load (lbs./in. ²) for slenderness ratio 1/r =			
						200	250	300	350
B1.....	4 4 $\frac{1}{2}$	4 2	1 $\frac{1}{4}$ by 1 $\frac{1}{4}$ by 1 $\frac{1}{8}$	5 $\frac{1}{2}$	9,070				
B2.....	6 5 $\frac{1}{2}$	6 3	1 $\frac{1}{4}$ by 1 $\frac{1}{4}$ by 1 $\frac{1}{8}$	5 $\frac{1}{2}$				5,380	
B6.....	4 2 $\frac{1}{2}$	4 0	1 $\frac{1}{4}$ by 1 $\frac{1}{4}$ by 1 $\frac{1}{8}$	5 $\frac{1}{2}$	10,710				
B7.....	6 2 $\frac{1}{2}$	6 0	1 $\frac{1}{4}$ by 1 $\frac{1}{4}$ by 1 $\frac{1}{8}$	5 $\frac{1}{2}$				5,250	
B8.....	5 2 $\frac{1}{2}$	5 0	1 $\frac{1}{2}$ by 1 $\frac{1}{2}$ by 1 $\frac{1}{8}$	1 $\frac{1}{2}$	8,500				
B9.....	6 5 $\frac{1}{2}$	6 3	1 $\frac{1}{2}$ by 1 $\frac{1}{2}$ by 1 $\frac{1}{8}$	1 $\frac{1}{2}$			6,460		
B10.....	7 8 $\frac{1}{2}$	7 6	1 $\frac{1}{2}$ by 1 $\frac{1}{2}$ by 1 $\frac{1}{8}$	1 $\frac{1}{2}$			4,660		
B11.....	5 0 $\frac{1}{2}$	4 10	1 $\frac{1}{2}$ by 1 $\frac{1}{2}$ by 1 $\frac{1}{8}$	1 $\frac{1}{2}$	10,150				
B12.....	7 5 $\frac{1}{2}$	7 3	1 $\frac{1}{2}$ by 1 $\frac{1}{2}$ by 1 $\frac{1}{8}$	1 $\frac{1}{2}$			5,950		
B13.....	8 6 $\frac{1}{2}$	8 4	2 by 2 by 1 $\frac{1}{8}$	1	5,210				
B14.....	10 2 $\frac{1}{2}$	10 0	2 by 2 by 1 $\frac{1}{8}$	1				4,000	
B17.....	8 6 $\frac{1}{2}$	8 4	2 by 2 by 1 $\frac{1}{8}$	1			5,500		
B18.....	10 2 $\frac{1}{2}$	10 0	2 by 2 by 1 $\frac{1}{8}$	1			4,450		
B19.....	10 7 $\frac{1}{2}$	10 5	2 $\frac{1}{2}$ by 2 $\frac{1}{2}$ by 1 $\frac{1}{8}$	1 $\frac{1}{2}$	5,500				
B20.....	12 8 $\frac{1}{2}$	12 6	2 $\frac{1}{2}$ by 2 $\frac{1}{2}$ by 1 $\frac{1}{8}$	1 $\frac{1}{2}$	3,350				
B21.....	14 9 $\frac{1}{2}$	14 7	2 $\frac{1}{2}$ by 2 $\frac{1}{2}$ by 1 $\frac{1}{8}$	1 $\frac{1}{2}$				2,610	
B22.....	12 5 $\frac{1}{2}$	12 3	2 $\frac{1}{2}$ by 2 $\frac{1}{2}$ by 1 $\frac{1}{8}$	1 $\frac{1}{2}$			4,000		
B23.....	10 5 $\frac{1}{2}$	10 2 $\frac{1}{2}$	2 $\frac{1}{2}$ by 2 $\frac{1}{2}$ by 1 $\frac{1}{8}$	1 $\frac{1}{2}$	6,000				
B24.....	12 5 $\frac{1}{2}$	12 3	2 $\frac{1}{2}$ by 2 $\frac{1}{2}$ by 1 $\frac{1}{8}$	1 $\frac{1}{2}$	4,760				
B25.....	14 6	14 3 $\frac{1}{2}$	2 $\frac{1}{2}$ by 2 $\frac{1}{2}$ by 1 $\frac{1}{8}$	1 $\frac{1}{2}$	3,320				
B26.....	12 8 $\frac{1}{2}$	12 6	3 by 3 by 1 $\frac{1}{8}$	1 $\frac{1}{2}$	4,670				
B27.....	15 2 $\frac{1}{2}$	15 0	3 by 3 by 1 $\frac{1}{8}$	1 $\frac{1}{2}$	3,150				
B28.....	17 8 $\frac{1}{2}$	17 6	3 by 3 by 1 $\frac{1}{8}$	1 $\frac{1}{2}$	2,210				
B29.....	15 2 $\frac{1}{2}$	15 0	3 by 3 by 1 $\frac{1}{8}$	1 $\frac{1}{2}$	3,890				
B29A.....	15 2 $\frac{1}{2}$	15 0	3 by 3 by 1 $\frac{1}{8}$	1 $\frac{1}{2}$	3,880				
B30.....	12 6	12 3 $\frac{1}{2}$	3 by 3 by 1 $\frac{1}{4}$	1 $\frac{1}{2}$	5,500				
B30A.....	12 6	12 3 $\frac{1}{2}$	3 by 3 by 1 $\frac{1}{4}$	1 $\frac{1}{2}$	5,400				
BX30.....	12 6	12 3 $\frac{1}{2}$	3 by 3 by 1 $\frac{1}{4}$	1 $\frac{1}{2}$	5,420				
B31.....	14 11 $\frac{1}{2}$	14 9	3 by 3 by 1 $\frac{1}{4}$	1 $\frac{1}{2}$	3,930				
BX31.....	14 11 $\frac{1}{2}$	14 9	3 by 3 by 1 $\frac{1}{4}$	1 $\frac{1}{2}$	4,450				
B32.....	17 5	17 2 $\frac{1}{2}$	3 by 3 by 1 $\frac{1}{4}$	1 $\frac{1}{2}$				2,750	
BX32.....	17 5	17 2 $\frac{1}{2}$	3 by 3 by 1 $\frac{1}{4}$	1 $\frac{1}{2}$	3,270				
B33.....	17 5 $\frac{1}{2}$	17 3	3 $\frac{1}{2}$ by 3 $\frac{1}{2}$ by 1 $\frac{1}{8}$	1 $\frac{1}{2}$	4,000				
B34.....	20 4	20 1 $\frac{1}{2}$	3 $\frac{1}{2}$ by 3 $\frac{1}{2}$ by 1 $\frac{1}{8}$	1 $\frac{1}{2}$	2,920				
B35.....	17 5 $\frac{1}{2}$	17 3	3 $\frac{1}{2}$ by 3 $\frac{1}{2}$ by 1 $\frac{1}{8}$	1 $\frac{1}{2}$	3,540				
B36.....	20 4	20 1 $\frac{1}{2}$	3 $\frac{1}{2}$ by 3 $\frac{1}{2}$ by 1 $\frac{1}{8}$	1 $\frac{1}{2}$				2,720	
B37.....	11 5 $\frac{1}{2}$	11 3	3 $\frac{1}{2}$ by 2 $\frac{1}{2}$ by 1 $\frac{1}{8}$	1 $\frac{1}{2}$	5,000				
B38.....	13 8 $\frac{1}{2}$	13 6	3 $\frac{1}{2}$ by 2 $\frac{1}{2}$ by 1 $\frac{1}{8}$	1 $\frac{1}{2}$	3,410				
B39.....	15 11 $\frac{1}{2}$	15 9	3 $\frac{1}{2}$ by 2 $\frac{1}{2}$ by 1 $\frac{1}{8}$	1 $\frac{1}{2}$	3,500				
Average.....					9,610	5,460	4,240	2,910	

TABLE 3.—Results of Compression Tests on Angles with One Bolt Connection in One Leg Only, Ends Folded.




Fig. 6.

Specimen No.	Length L.	Distance M.	Size angle.	Distance N.	Diameter of holes.	Maximum load (lbs./in. ²) for slenderness ratio 1/r =		
						100	200	300
B3.....	2 3 $\frac{1}{2}$	2 1	1 $\frac{1}{4}$ by 1 $\frac{1}{4}$ by 1 $\frac{1}{8}$	1 $\frac{1}{2}$	14,900			
B4.....	4 4 $\frac{1}{2}$	4 2	1 $\frac{1}{4}$ by 1 $\frac{1}{4}$ by 1 $\frac{1}{8}$	1 $\frac{1}{2}$		9,250		
B15.....	6 10 $\frac{1}{2}$	6 8	2 by 2 by 1 $\frac{1}{8}$	1	7,400			
B16.....	10 2 $\frac{1}{2}$	10 0	2 by 2 by 1 $\frac{1}{8}$	1		4,500		
Average.....					14,900	8,325	4,500	

TABLE 4.—Results of Compression Tests on Angles with Two Bolt Connections, One Leg Only, Plain Ends.




Fig. 7.

Specimen No.	Length L.	Distance M.	Size angles.	Distance N.	Diameter of holes.	Maximum load (lbs./in. ²) for slenderness ratio 1/r =			
						100	150	200	250
	Ft. in.	Ft. in.	Inches.	Inches.	Inch.				
C1.....	2 5 ³ / ₄	1 10 ³ / ₄	1 ¹ / _{2 by 1¹/_{2 by 1¹/_{8.....}}}	5 ⁵ / ₈	1 ¹ / ₈	27, 200			
C2.....	2 4 ³ / ₄	1 9 ³ / ₄	1 ¹ / _{2 by 1¹/_{2 by 1¹/_{8.....}}}	5 ⁵ / ₈	1 ¹ / ₈	24, 200			
C3.....	2 10 ³ / ₄	2 3 ³ / ₄	1 ¹ / _{2 by 1¹/₂ by 1¹/_{8.....}}	1 ¹ / ₂	1 ¹ / ₈	23, 500			
C3a.....	2 10 ³ / ₄	2 3 ³ / ₄	1 ¹ / _{2 by 1¹/₂ by 1¹/_{8.....}}	1 ¹ / ₂	1 ¹ / ₈	24, 000			
C4.....	4 1 ³ / ₄	3 6 ³ / ₄	1 ¹ / _{2 by 1¹/_{2 by 1¹/_{8.....}}}	1 ¹ / ₂	1 ¹ / ₈	19, 470			
C5.....	2 9 ³ / ₄	2 2 ³ / ₄	1 ¹ / _{2 by 1¹/_{2 by 1¹/_{6.....}}}	1 ¹ / ₂	1 ¹ / ₈	26, 900			
C6.....	4 0 ³ / ₄	3 5 ¹ / ₄	1 ¹ / _{2 by 1¹/₂ by 1¹/_{6.....}}	1 ¹ / ₂	1 ¹ / ₈	23, 400			
C7.....	5 4 ³ / ₄	4 9 ³ / ₄	2 by 2 by 1 ¹ / _{8.....}	1	1 ¹ / ₈	15, 350			
C8.....	7 0 ³ / ₄	6 5 ³ / ₄	2 by 2 by 1 ¹ / _{8.....}	1	1 ¹ / ₈		14, 500		
C11.....	5 4 ³ / ₄	4 9 ³ / ₄	2 by 2 by 1 ¹ / _{8.....}	1	1 ¹ / ₈	18, 500			
C12.....	7 0 ³ / ₄	6 5 ³ / ₄	2 by 2 by 1 ¹ / _{8.....}	1	1 ¹ / ₈		14, 200		
C13.....	6 7 ³ / ₄	6 0 ³ / ₄	2 ¹ / _{2 by 2¹/_{2 by 1¹/_{8.....}}}	1 ¹ / ₂	1 ¹ / ₈	13, 800			
C14.....	8 8 ³ / ₄	8 1 ³ / ₄	2 ¹ / _{2 by 2¹/₂ by 1¹/_{8.....}}	1 ¹ / ₂	1 ¹ / ₈	10, 910			
C15.....	6 6 ³ / ₄	5 11 ³ / ₄	2 ¹ / _{2 by 2¹/_{2 by 1¹/_{6.....}}}	1 ¹ / ₂	1 ¹ / ₈	17, 250			
C16.....	8 6 ³ / ₄	7 11 ³ / ₄	2 ¹ / _{2 by 2¹/_{2 by 1¹/_{6.....}}}	1 ¹ / ₂	1 ¹ / ₈	13, 830			
C17.....	6 6 ³ / ₄	5 11 ³ / ₄	2 ¹ / _{2 by 2¹/_{2 by 1¹/_{4.....}}}	1 ¹ / ₂	1 ¹ / ₈	16, 995			
C18.....	8 6 ³ / ₄	7 11 ³ / ₄	2 ¹ / ₂ by 2 ¹ / ₂ by 1 ¹ / ₄	1 ¹ / ₂	1 ¹ / ₈	12, 780			
C19.....	7 10 ³ / ₄	7 3 ³ / ₄	3 by 3 by 1 ¹ / _{8.....}	1 ¹ / ₂	1 ¹ / ₈	12, 400			
C20.....	10 4 ³ / ₄	9 5 ³ / ₄	3 by 3 by 1 ¹ / ₈	1 ¹ / ₂	1 ¹ / ₈		8, 950		
C21.....	10 4 ³ / ₄	9 9 ³ / ₄	3 by 3 by 1 ¹ / ₈	1 ¹ / ₂	1 ¹ / ₈		12, 520		
C21a.....	10 4 ³ / ₄	9 9 ³ / ₄	3 by 3 by 1 ¹ / ₈	1 ¹ / ₂	1 ¹ / ₈		13, 400		
C22.....	7 9 ³ / ₄	7 2 ³ / ₄	3 by 3 by 1 ¹ / ₄	1 ¹ / ₂	1 ¹ / ₈	15, 210			
C22a.....	7 9 ³ / ₄	7 2 ³ / ₄	3 by 3 by 1 ¹ / ₄	1 ¹ / ₂	1 ¹ / ₈	16, 400			
C23.....	10 2 ³ / ₄	9 7 ³ / ₄	3 by 3 by 1 ¹ / ₄	1 ¹ / ₂	1 ¹ / ₈		11, 700		
C23a.....	10 2 ³ / ₄	9 7 ³ / ₄	3 by 3 by 1 ¹ / ₄	1 ¹ / ₂	1 ¹ / ₈		12, 530		
C24.....	10 2 ³ / ₄	9 7 ³ / ₄	3 by 3 by 1 ¹ / ₅	1 ¹ / ₂	1 ¹ / ₈		11, 800		
C24a.....	10 2 ³ / ₄	9 7 ³ / ₄	3 by 3 by 1 ¹ / ₅	1 ¹ / ₂	1 ¹ / ₈		12, 570		
C25.....	12 8 ³ / ₄	12 1 ³ / ₄	3 by 3 by 1 ¹ / ₅	1 ¹ / ₂	1 ¹ / ₈			10, 000	
C25a.....	12 8 ³ / ₄	12 1 ³ / ₄	3 by 3 by 1 ¹ / ₅	1 ¹ / ₂	1 ¹ / ₈			8, 350	
C26.....	11 10 ³ / ₄	11 3 ³ / ₄	3 ¹ / _{2 by 3¹/_{2 by 1¹/₆.....}}	1 ¹ / ₂	1 ¹ / ₈		11, 300		
C27.....	14 9 ¹ / ₄	14 2 ¹ / ₄	3 ¹ / _{2 by 3¹/_{2 by 1¹/₆.....}}	1 ¹ / ₂	1 ¹ / ₈			8, 350	
C28.....	11 10 ³ / ₄	11 3 ³ / ₄	3 ¹ / _{2 by 3¹/₂ by 1¹/₄.....}	1 ¹ / ₂	1 ¹ / ₈			9, 870	
C28a.....	11 10 ³ / ₄	11 3 ³ / ₄	3 ¹ / _{2 by 3¹/₂ by 1¹/₄.....}	1 ¹ / ₂	1 ¹ / ₈			10, 400	
C29.....	14 9 ¹ / ₄	14 2 ¹ / ₄	3 ¹ / _{2 by 3¹/₂ by 1¹/₄.....}	1 ¹ / ₂	1 ¹ / ₈			6, 300	
C29a.....	14 9 ¹ / ₄	14 2 ¹ / ₄	3 ¹ / ₂ by 3 ¹ / ₂ by 1 ¹ / ₄	1 ¹ / ₂	1 ¹ / ₈			7, 850	
C30.....	14 9 ¹ / ₄	14 2 ¹ / ₄	3 ¹ / ₂ by 3 ¹ / ₂ by 1 ⁵ / ₈	1 ¹ / ₂	1 ¹ / ₈			8, 800	
C30a.....	14 9 ¹ / ₄	14 2 ¹ / ₄	3 ¹ / ₂ by 3 ¹ / ₂ by 1 ⁵ / ₈	1 ¹ / ₂	1 ¹ / ₈			9, 100	
C31.....	9 4 ³ / ₄	8 9 ³ / ₄	3 ¹ / ₂ by 2 ¹ / ₂ by 1 ¹ / ₄	1 ¹ / ₂	1 ¹ / ₈			11, 800	
Average.....						25, 200	16, 880	12, 050	8, 400

TABLE 5.—Results of Compression Tests on Angles with Two Bolt Connections, One Leg Only, Ends Folded.



Fig. 8.

Specimen No.	Length L.	Distance M.	Size angle.	Diameter of holes.	Maximum load (lbs./in. ²) for slenderness ratio 1/r =	
					50	100
C9.....	Ft. in. 2 0 ³ / ₄	Ft. in. 1 5 ³ / ₄	2 by 2 by 1 ¹ / ₈	Inch. 1 ¹ / ₈	16,530
C10.....	3 8 ³ / ₄	3 1 ³ / ₄	2 by 2 by 1 ¹ / ₈	1 ¹ / ₈	18,000

TABLE 6.—Results of Compression Tests on Angles with Two Bolt Connections, One Bolt in Each Leg.



Fig. 9.

Specimens No. D1-D10.




Fig. 10.

Specimens No. E1-E8.

Specimen No.	Length L.	Distance M.	Size angle.	Diameter of holes.	Maximum load (lbs./in. ²) for slenderness ratio 1/r =			
					200	250	300	350
D1.....	Ft. in. 10 3	Ft. in. 10 0	Inches. 3 by 3 by 3 ¹ / ₁₆	Inch. 1 ¹ / ₈	13,820
D2.....	12 9	12 6	3 by 3 by 3 ¹ / ₁₆	1 ¹ / ₈	10,980
D3.....	10 1	9 10	3 by 3 by 3 ¹ / ₄	1 ¹ / ₈	11,620
DX3.....	10 1	9 10	3 by 3 by 3 ¹ / ₄	1 ¹ / ₈	12,400
D4.....	12 6 ¹ / ₂	12 3 ¹ / ₂	3 by 3 by 3 ¹ / ₄	1 ¹ / ₈	9,760
DX4.....	12 6 ¹ / ₂	12 3 ¹ / ₂	3 by 3 by 3 ¹ / ₄	1 ¹ / ₈	8,500
D5.....	10 1	9 10	3 by 3 by 3 ¹ / ₁₆	1 ¹ / ₈	13,700
DX5.....	10 1	9 10	3 by 3 by 3 ¹ / ₁₆	1 ¹ / ₈	13,600
D6.....	11 9	11 6	3 ¹ / _{2 by 3¹/₂ by 3¹/₄.....}	1 ¹ / ₈	9,420
D7.....	14 7 ¹ / ₂	14 4 ¹ / ₂	3 ¹ / ₂ by 3 ¹ / ₂ by 3 ¹ / ₄	1 ¹ / ₈	10,300
D8.....	17 6	17 3	3 ¹ / ₂ by 3 ¹ / ₂ by 3 ¹ / ₄	1 ¹ / ₈	6,520
D9.....	14 7 ¹ / ₂	14 4 ¹ / ₂	3 ¹ / ₂ by 3 ¹ / ₂ by 3 ¹ / ₈	1 ¹ / ₈	9,000
D10.....	17 6	17 3	3 ¹ / ₂ by 3 ¹ / ₂ by 3 ¹ / ₈	1 ¹ / ₈	6,130
E1.....	16 8 ¹ / ₂	16 5 ¹ / ₂	4 by 4 by 3 ¹ / ₄	1 ¹ / ₈	5,960
E2.....	20 0	19 9	4 by 4 by 3 ¹ / ₄	1 ¹ / ₈	4,530
E3.....	23 3 ¹ / ₂	23 0 ¹ / ₂	4 by 4 by 3 ¹ / ₄	1 ¹ / ₈	5,000
E4.....	20 0	19 9	4 by 4 by 3 ¹ / ₈	1 ¹ / ₈	4,280
E5.....	16 8 ¹ / ₂	16 5 ¹ / ₂	4 by 4 by 3 ¹ / ₈	1 ¹ / ₈	6,580	4,980
E6.....	20 0	19 9	4 by 4 by 3 ¹ / ₈	1 ¹ / ₈	4,980
E7.....	23 3 ¹ / ₂	23 0 ¹ / ₂	4 by 4 by 3 ¹ / ₈	1 ¹ / ₈	4,270
E8.....	19 9	19 6	4 by 4 by 3 ¹ / ₂	1 ¹ / ₈	3,930
Average.....	12,400	8,720	5,060	4,630

TABLE 7.—Results of Compression Tests on Angles with Two or More Bolts in Each Leg.



FIG. 11.

Specimens No. D11-D21.



FIG. 12.

Specimens No. D22-D37.



FIG. 13.

Specimens No. E10-E12.



FIG. 14.

Specimens No. E14-E20.



FIG. 15.

Specimens No. E21-E32.

Specimen No.	Length L.	Distance M.	Size angle.	Distance N.	Distance K.	
					Ft. in.	Inches.
D11.....	5 5 1/2	4 9 1/2	3 by 3 by 1/4	13 1/4		
D12.....	7 11 1/2	7 31 1/2	3 by 3 by 1/8	13 1/4		
D13.....	5 4 1/2	4 8 1/2	3 by 3 by 1/4	13 1/4		
D14.....	7 10	7 2	3 by 3 by 1/4	13 1/4		
D15.....	7 10	7 2	3 by 3 by 1/16	13 1/4		
D16.....	10 11 1/2	9 5 1/2	3 by 3 by 1/8	13 1/4		
D17.....	9 1	8 5	3 1/2 by 3 1/2 by 1/4	13 1/4		
D18.....	9 1	8 5	3 1/2 by 3 1/2 by 1/8	13 1/4		
D19.....	11 11 1/2	11 3 1/2	3 1/2 by 3 1/2 by 1/8	13 1/4		
D20.....	11 11 1/2	11 3 1/2	3 1/2 by 3 1/2 by 1/8	13 1/4		
D21.....	11 9 1/2	11 1 1/2	3 1/2 by 3 1/2 by 1/2	13 1/4		
D22.....	3 2	2 1	3 by 3 by 1/2	13 1/4		
D23.....	3 1 1/2	2 0 1/2	3 by 3 by 1/4	13 1/4		
D24.....	3 4	1 10	3 by 3 by 1/16	13 1/4		
D25.....	5 7	4 6	3 by 3 by 1/16	13 1/4		
D26.....	3 6	1 7	3 by 3 by 1/8	13 1/4		
D28.....	6 4	4 5	3 by 3 by 1/8	13 1/4		
D28A.....	6 4	4 5	3 by 3 by 1/8	13 1/4		
D29.....	3 9	2 3	3 1/2 by 3 1/2 by 1/4	13 1/4		
D30.....	6 5	5 4	3 1/2 by 3 1/2 by 1/4	13 1/4		
D31.....	3 11 1/2	2 0 1/2	3 1/2 by 3 1/2 by 1/8	13 1/4		
D33.....	7 8	5 4	3 1/2 by 3 1/2 by 1/8	13 1/4		
D33A.....	7 8	5 4	3 1/2 by 3 1/2 by 1/8	13 1/4		
D34.....	4 2	1 10	3 1/2 by 3 1/2 by 1/2	13 1/4		
D35.....	6 7 1/2	5 1 1/2	3 1/2 by 3 1/2 by 1/8	13 1/4		
D35A.....	6 7 1/2	5 1 1/2	3 1/2 by 3 1/2 by 1/8	13 1/4		
D36.....	4 4	1 7	3 1/2 by 3 1/2 by 1/2	13 1/4		
D36A.....	4 4	1 7	3 1/2 by 3 1/2 by 1/2	13 1/4		
D37.....	6 9	4 10	3 1/2 by 3 1/2 by 1/2	13 1/4		
D37A.....	6 9	4 10	3 1/2 by 3 1/2 by 1/2	13 1/4		
E10.....	13 7	13 0	4 by 4 by 1/4	1 1/2	13 1/8	
E11.....	13 7	13 0	4 by 4 by 1/16	1 1/2	13 1/8	
E12.....	13 7	13 0	4 by 4 by 1/8	1 1/2	13 1/8	
E14.....	7 2	6 3	4 by 4 by 1/4	1 1/2	13 1/8	
E15.....	4 2 1/2	2 7 1/2	4 by 4 by 1/16	1 1/2	13 1/8	
E16.....	10 5 1/2	9 6 1/2	4 by 4 by 1/8	1 1/2	13 1/8	
E17.....	7 5	5 10	4 by 4 by 1/2	1 1/2	13 1/8	
E18.....	6 2 1/2	3 11 1/2	6 by 6 by 1/8	2 1/2	2 1/4	
E19.....	15 5 1/2	14 6 1/2	6 by 6 by 1/8	2 1/2	2 1/4	
E20.....	20 3	19 4	6 by 6 by 1/2	2 1/2	2 1/4	
E21.....	4 0 1/2	2 9 1/2	4 by 4 by 1/4	1 1/2	13 1/8	
E22.....	7 4	6 1	4 by 4 by 1/16	1 1/2	13 1/8	
E23.....	4 4 1/2	2 5 1/2	4 by 4 by 1/8	1 1/2	13 1/8	
E24.....	7 4	6 1	4 by 4 by 1/8	1 1/2	13 1/8	
E25.....	4 8	2 1	4 by 4 by 1/2	1 1/2	13 1/8	
E26.....	10 8	9 5	6 by 6 by 1/8	2 1/2	2 1/4	
E27.....	6 4	3 9	6 by 6 by 1/2	2 1/2	2 1/4	
E28.....	10 11	9 0	6 by 6 by 1/2	2 1/2	2 1/4	
E29.....	15 6	14 3	6 by 6 by 1/2	2 1/2	2 1/4	
E30.....	6 11 1/2	3 0 1/2	6 by 6 by 1/4	2 1/2	2 1/4	
E30A.....	6 11 1/2	3 0 1/2	6 by 6 by 1/4	2 1/2	2 1/4	
E31.....	11 2	8 7	6 by 6 by 1/4	2 1/2	2 1/4	
E32.....	12 6	8 7	6 by 6 by 1/4	2 1/2	2 1/4	

TABLE 7.—Results of Compression Tests on Angles with Two or More Bolts in Each Leg—Continued.

Specimen No.	Diameter of holes.	Number of holes in each leg.	Maximum load (lbs./in. ²) for slenderness ratio $l/r =$			
			50	100	150	200
D11	1 ¹ / ₈	2	36,800			
D12	1 ¹ / ₈	2		26,050		
D13	1 ¹ / ₈	2	32,400			
D14	1 ¹ / ₈	2		29,900		
D15	1 ¹ / ₈	2		29,900		
D16	1 ¹ / ₈	2			22,700	
D17	1 ¹ / ₈	2		25,000		
D18	1 ¹ / ₈	2		25,000		
D19	1 ¹ / ₈	2			17,700	
D20	1 ¹ / ₈	2			19,900	
D21	1 ¹ / ₈	2				15,800
D22	1 ¹ / ₈	3	41,000			
D23	1 ¹ / ₈	3	35,500			
D24	1 ¹ / ₈	4	36,000			
D25	1 ¹ / ₈	3		35,300		
D26	1 ¹ / ₈	5	35,500			
D28	1 ¹ / ₈	5		33,800		
D28A	1 ¹ / ₈	5		31,600		
D29	1 ¹ / ₈	4	35,000			
D30	1 ¹ / ₈	3		33,000		
D31	1 ¹ / ₈	5	36,000			
D33	1 ¹ / ₈	6		34,000		
D33A	1 ¹ / ₈	6		35,700		
D34	1 ¹ / ₈	6	38,000			
D35	1 ¹ / ₈	4		34,900		
D35A	1 ¹ / ₈	4		34,000		
D36	1 ¹ / ₈	7	41,800			
D36A	1 ¹ / ₈	7	41,200			
D37	1 ¹ / ₈	5		34,100		
D37A	1 ¹ / ₈	5		33,900		
E10	1 ¹ / ₈	2				14,250
E11	1 ¹ / ₈	2				16,700
E12	1 ¹ / ₈	2				20,150
E14	1 ¹ / ₈	3		33,500		
E15	1 ¹ / ₈	5	37,000			
E16	1 ¹ / ₈	3			25,600	
E17	1 ¹ / ₈	5		30,000		
E18	1 ¹ / ₈	7	31,600			
E19	1 ¹ / ₈	3			22,800	
E20	1 ¹ / ₈	3				20,000
E21	1 ¹ / ₈	4	37,500			
E22	1 ¹ / ₈	4		34,480		
E23	1 ¹ / ₈	6	36,200			
E24	1 ¹ / ₈	4		33,000		
E25	1 ¹ / ₈	8	31,000			
E26	1 ³ / ₈	4		30,200		
E27	1 ³ / ₈	8	28,300			
E28	1 ³ / ₈	6		27,900		
E29	1 ³ / ₈	4			27,750	
E30	1 ³ / ₈	12	31,700			
E30A	1 ³ / ₈	12	32,150			
E31	1 ³ / ₈	8		35,000		
E32	1 ³ / ₈	12		28,820		

TABLE 8.—Results of Tests on Coupon Specimens.

Test numbers.	Size angle.	Chemical analysis (per cent.).				Yield point.	Tensile strength.	Elong- ation in 8 inches.	Re- duc- tion of area.
		C.	Mn.	P.	S.				
Inches.									
B1, B2, B3, B4, C1.....	1 $\frac{1}{2}$ by 1 $\frac{1}{2}$ by $\frac{1}{8}$								
B6, B7, C2.....	1 $\frac{1}{2}$ by 1 $\frac{1}{2}$ by $\frac{1}{8}$	0.18	0.43	0.018	0.036				
B8, B9, B10, C3, C4.....	1 $\frac{1}{2}$ by 1 $\frac{1}{2}$ by $\frac{1}{8}$.20	.49	.016	.049				
B11, B12, C5, C6.....	1 $\frac{1}{2}$ by 1 $\frac{1}{2}$ by $\frac{1}{8}$.22	.57	.015	.043				
B13, B14, B15, B16, C7, C8, C9, C10.....	2 by 2 by $\frac{1}{8}$.19	.49	.039	.045				
B17, B18, C11, C12.....	2 by 2 by $\frac{1}{8}$.17	.48	.014	.036				
B19, B20, B21, C13, C14.....	2 $\frac{1}{2}$ by 2 $\frac{1}{2}$ by $\frac{1}{8}$								
B22, C15, C16.....	2 $\frac{1}{2}$ by 2 $\frac{1}{2}$ by $\frac{1}{8}$								
B23, B24, B25, C17, C18.....	2 $\frac{1}{2}$ by 2 $\frac{1}{2}$ by $\frac{1}{8}$								
B26, B27, B28, C19, C20.....	3 by 3 by $\frac{1}{8}$								
A1, A2, A3, B29, C21, D1, D2, D11, D12, D22.....	3 by 3 by $\frac{1}{8}$.22	.40	.016	.045	37,320	62,300	30.0	54.0
A4, A5, A6, A7, A8, A9, A10, B30, B31, B32.....	3 by 3 by $\frac{1}{4}$.22	.41	.024	.042	36,710	58,020	28.7	55.7
C22, C23, D3, D4, D13, D14, D23.....	3 by 3 by $\frac{1}{8}$								
C24, C25 D5, D15, D24, D25.....	3 by 3 by $\frac{1}{8}$.18	.36	.036	.044	36,080	58,980	30.0	53.2
D16, D26, D28.....	3 by 3 by $\frac{1}{8}$.21	.34	.012	.040	36,840	65,540	27.5	49.6
B33, B34, C26, C27.....	3 $\frac{1}{2}$ by 3 $\frac{1}{2}$ by $\frac{1}{8}$.21	.36	.025	.040	38,000	57,930	28.7	52.8
A11, A12, A13, B35, B36, C28, C29, D6, D7, D8, D17, D29, D30.....	3 $\frac{1}{2}$ by 3 $\frac{1}{2}$ by $\frac{1}{4}$								
C30, D9, D10, D18, D19, D31, D33.....	3 $\frac{1}{2}$ by 3 $\frac{1}{2}$ by $\frac{1}{8}$								
D20, D34, D35.....	3 $\frac{1}{2}$ by 3 $\frac{1}{2}$ by $\frac{1}{8}$								
D21, D36, D37.....	3 $\frac{1}{2}$ by 3 $\frac{1}{2}$ by $\frac{1}{8}$								
E1, E2, E3, E9, E10, E14, E21.....	4 by 4 by $\frac{1}{4}$.21	.44	.020	.037	35,850	58,600	26.2	52.2
E4, E11, E15, E22.....	4 by 4 by $\frac{1}{8}$								
E5, E6, E7, E12, E16, E23, E24.....	4 by 4 by $\frac{1}{8}$								
E8, E17, E25.....	4 by 4 by $\frac{1}{2}$.25	.53	.013	.040	35,780	64,750	30.0	50.9
E13, E18, E19, E26.....	6 by 6 by $\frac{1}{2}$.21	.43	.014	.046	36,200	57,920	30.0	53.9
E20, E27, E28, E29.....	6 by 6 by $\frac{1}{2}$.24	.39	.013	.031	36,520	60,090	28.7	52.9
E30, E31, E32.....	6 by 6 by $\frac{1}{2}$.22	.40	.032	.040	36,890	62,950	28.7	52.8
B37, B38, B39, C31.....	3 $\frac{1}{2}$ by 2 $\frac{1}{2}$ by $\frac{1}{4}$.21	.35	.015	.030	36,870	60,780	27.5	52.1

TABLE 9.—Comparison of Lateral Deflection to Strength of Angles with One Bolt Connection.

Specimen No.	Slender- ness ratio.	Lateral deflection at 4/9 S.	Rank.		
			By strength.	By deflec- tion.	Differ- ence in—
	1/r	Inch.			
B1.....	200	.11	3	2	1
B6.....	200	.06	1	1	0
B8.....	200	.17	4	4	0
B11.....	200	.16	2	3	1
B9.....	250	.10	1	1	0
B13.....	250	.20	8	4	4
B17.....	250	.23	3-5	5	0
B19.....	250	.19	3-5	2-3	0
B23.....	250	.19	2	2-3	0
B26.....	250	.33	10	10	0
B30.....	250	.25	3-5	6-7	1
B38.....	250	.31	7	8	1
BX30.....	250	.25	6	6-7	0
B37.....	250	.32	9	9	0
B2.....	300	.13	2	1	1
B7.....	300	.15	3	2-3	0
B10.....	300	.16	5	4	1
B12.....	300	.15	1	2-3	1
B14.....	300	.17	8-10	5	3
B18.....	300	.24	6-7	10-11	3
B20.....	300	.54	16	16	0
B22.....	300	.25	8-10	12	2
B24.....	300	.20	4	6-7	2
B27.....	300	.73	17	17	0
B29.....	300	.21	12	8	4
B29A.....	300	.24	13	10-11	2
B31.....	300	.32	11	13	2
BX31.....	300	.23	6-7	9	2
B33.....	300	.20	8-10	6-7	1
B35.....	300	.40	14	14	0
B38.....	300	.49	15	15	0
B21.....	350	.36	7	5	2
B25.....	350	.27	2	4	2
B28.....	350	.42	8	6	2
B32.....	350	.64	5	8	3
BX32.....	350	.15	3	1	2
B34.....	350	.21	4	3	1
B36.....	350	.50	6	7	1
B39.....	350	.20	1	2	1

TABLE 10.—Comparison of Lateral Deflection to Strength of Angles with Two Bolt Connections in One Leg Only.

Specimen No.	Slender- ness ratio.	Lateral deflection at 4/9 S.	Rank.		
			By strength.	By deflec- tion.	Differ- ence in—
	1/r	Inch.			
C4.....	150	.12	2	2	0
C6.....	150	.10	1	1	0
C7.....	150	.23	7	5	2
C11.....	150	.17	3	3	0
C13.....	150	.32	9	9	0
C15.....	150	.25	4	6-7	2
C17.....	150	.20	5	4	1
C19.....	150	.23	10	10	0
C22.....	150	.27	8	8	0
C22A.....	150	.25	6	6-7	0
C8.....	200	.19	1	2-3	1
C12.....	200	.13	2	1	1
C14.....	200	.24	13	6-9	4
C16.....	200	.20	3	4	1
C18.....	200	.29	5	14	9
C20.....	200	.26	16	12	4
C21.....	200	.24	8	6-9	0
C21A.....	200	.24	4	6-9	2
C23.....	200	.26	11	11	0
C23A.....	200	.24	7	6-9	0
C24.....	200	.27	9-10	13	3
C24A.....	200	.23	6	5	1
C26.....	200	.25	12	10	2
C28.....	200	.35	15	16	1
C28A.....	200	.30	14	15	1
C31.....	200	.19	9-10	2-3	6
C25.....	250	.27	1	1	0
C25A.....	250	—	4-5	4	—
C27.....	250	.30	4-5	2	2
C29.....	250	.64	7	7	0
C29A.....	250	.32	6	5	1
C30.....	250	.35	3	6	3
C30A.....	250	.31	2	3	1

TABLE 11.—Comparison of Lateral Deflection to Strength of Angles with Two Bolt Connections, One Bolt in Each Leg.

Specimen No.	Slender- ness ratio.	Lateral deflection at 4/9 S.	Rank.		
			By strength.	By deflec- tion.	Differ- ence in—
	1/r	Inches.			
D1.....	200	.10	1	4	3
D3.....	200	.24	5	5	0
DX3.....	200	.08	4	2	2
D5.....	200	.05	2	1	1
DX5.....	200	.09	3	3	0
D6.....	200	.47	6	6	0
D2.....	250	.10	1	1-4	0
D4.....	250	.18	3	5	2
DX4.....	250	.10	5	1-4	1
D7.....	250	.10	2	1-4	0
D9.....	250	.10	4	1-4	0
E1.....	250	.46	7	7	0
E5.....	250	.35	6	6	0
D8.....	300	.27	1	1	0
D10.....	300	.48	2	4	2
E2.....	300	.35	4	3	1
E4.....	300	.81	5	5	0
E6.....	300	.31	3	2	1
E8.....	300	1.05	6	6	0
E3.....	350	.22	1	—	—
E7.....	350	.35	2	2	0

TABLE 12.—Comparison of Lateral Deflection to Strength of Angles with Two or More Bolts in Each Leg.

Specimen No.	Slender- ness ratio.	Lateral deflection at 4/9 S.	Rank.		
			By strength.	By deflec- tion.	Differ- ence in—
	1/r	Inch.			
D11.....	100	.03	1	2	0
D13.....	100	.05	15	5-14	1
D25.....	100	.05	3	5-14	2
D28.....	100	.09	11	17	6
D28A.....	100	.05	16	5-14	2
D30.....	100	.05	13	5-14	0
D33.....	100	.05	8	5-14	0
D33A.....	100	.04	2	3	1
D35.....	100	.05	5	5-14	0
D35A.....	100	.05	9	5-14	0
D37.....	100	.05	7	5-14	0
D37A.....	100	.05	10	5-14	0
E14.....	100	.05	12	5-14	0
E17.....	100	.08	18	16	2
E22.....	100	.02	6	1	5
E24.....	100	.08	14	15	1
E26.....	100	.30	17	19	2
E28.....	100	20	20
E31.....	100	4	4
E32.....	100	.12	19	18	1
D12.....	150	.10	4	4-5	0
D14.....	150	.05	1-2	1	0
D15.....	150	.09	1-2	3	1
D17.....	150	.10	6-7	4-5	1
D18.....	150	.06	6-7	2	4
E16.....	150	.15	5	6	1
E19.....	150	.22	8	7-8	0
E29.....	150	.22	3	7-8	4
D16.....	200	.10	1	4	3
D19.....	200	.16	4	6	2
D20.....	200	.05	3	2	1
D21.....	200	.12	6	5	1
E10.....	200	.19	7	7	0
E11.....	200	.07	5	3	2
E12.....	200	.03	2	1	1

TABLE 13.—End Fixation Factors for Various End Connections of Angles.

End connection.	Fixation factor.	End connection.	Fixation factor.
Angles with square ends, no bolts.....	1.9	Two bolts, one in each leg.....	1.3
Two or more bolts in each leg.....	1.5	One bolt.....	1.1
Two bolts, in one leg only.....	1.3	Ends folded.....	1.1

III. RESULTS AND DISCUSSION OF TESTS.

(a) GENERAL DISCUSSION.—The value of the maximum load sustained by each column was measured. These values are given in Tables 1 to 7, inclusive, and have been plotted against the values of the slenderness ratio l/r in Figures 16 and 17. In these figures the average value of the maximum loads for each slenderness ratio is shown by a solid circle. Full lines connect these average values. It will be noted from Figure 17 that for any given slenderness ratio the individual results are quite scattered, and when conclusions are drawn from the average values this fact must be kept in mind.

The manner in which the angles were held in the testing machine exerted a great influence on their strength. In other words, the strength of a column varies with the "degree of end fixation." The amount of this "end fixation" may be expressed by a fixation factor $f = l/L$, where l is the actual length of the member and L the length of the round end member which would fail under the same load; i. e., the "free length" of the member. Thus, the end fixation factor would be 1.0 for a column with round ends and 2.0 for a specimen tested with fixed ends.

The angles with square ends that were placed directly between the head and base of the testing machine would thus have an end

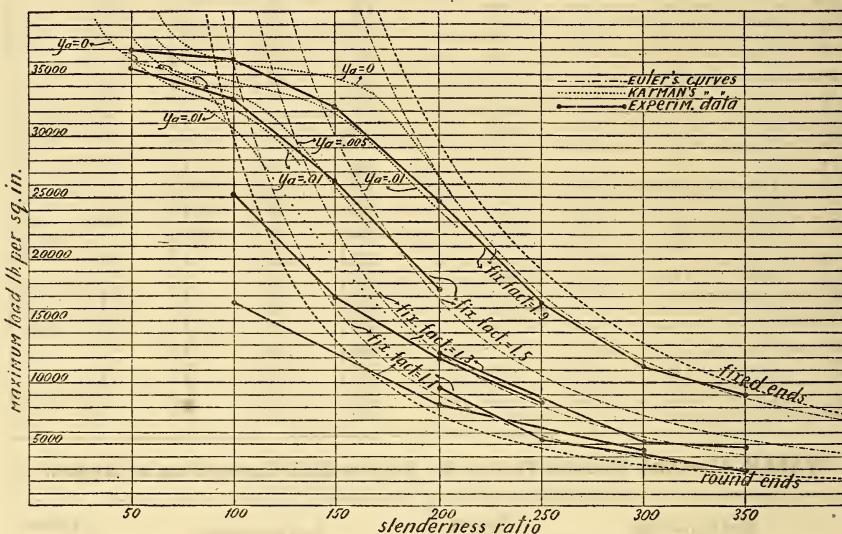


FIG. 16.—Relation of maximum load to slenderness ratio.

fixation of approximately the same degree as a column with theoretically fixed ends under axial loading, while specimens that were held with one bolt in one leg would be expected to approximate a round-end specimen under eccentric loading. When more than one bolt is used, the fixation factor would increase and approach 2.0 as the limit for the most rigidly held columns. End fixation factors for various end connections are given in Table 13.

It must be pointed out that in such column tests there is always present some eccentricity, due to imperfect centering in the testing machine and also to the manner in which the load is applied to the specimen, as by bolted connections. It is very difficult to accurately center even a short compression test specimen. The load was eccentric for all the angles bolted to their end con-

nctions, and this eccentricity of loading always produces a diminution of the maximum load.

The results of the tests were compared with several types of column formulas. Formulas of the Rankine-Gordon type represent the results fairly well for values of the slenderness ratio up to about 150, but the longer column results are evidently best represented by the Euler formula:

$$\frac{P}{a} = \frac{\pi^2 E}{\left(\frac{l}{f_r}\right)^2}$$

where P = total load, pounds.

a = cross-section area, square inches.

E = modulus of elasticity, pounds per square inch.

l = length of column, inches.

r = radius of gyration, inches.

and f = fixation factor.

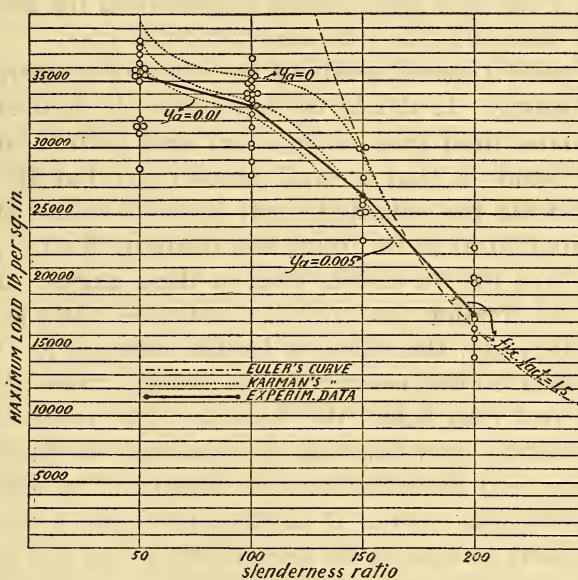


FIG. 17.—Relation of maximum load to slenderness ratio for fixation factor $f=1.5$.

The Euler formula does not give the strength of short columns, however, since for such lengths the elastic limit of the material is passed before the column fails. The theory of the deviation of short columns from Euler's law has been worked out by Considére (K. Considére, Résistance des Pièces Comprimées, Comptes Rendus, Congrès International des Procédés de Construction, pp. 371-397, 1891), Jasinsky (Jasinsky, Zu den Knickfragen, Schweiz. Bauzeitung, vol. 25, p. 172, 1895), and Kármán (Theo. von Kár-

mán, Untersuchung über Knickfestigkeit, Forschungsarbeiten a. d. Gebiete d. Ingenieurwesens, No. 81, 1910), and later independently by Southwell (R. V. Southwell, The Strength of Struts, Engineering, vol. 94, pp. 248-250, 1912; Aircraft Engineering, vol. 1, p. 20 et seq., January, 1920). The theoretical curve given by Kármán for a steel whose physical properties had been determined were recalculated for a yield point of 37,000 lbs./in.² and a modulus of elasticity of 30,000,000 lbs./in.² They were found to agree with the results of these tests when the end fixation factor was taken into account and the effect of eccentricity noted. This curve, which goes over into the Euler hyperbola for large values of the slenderness ratio, has been plotted for comparison with the average results of this test.

In Figures 16 and 17 the dashed curves represent the Euler formula for round and for fixed ends, as shown. The dash-and-dot curves shown represent the intermediate degree of end fixation for the Euler and their dotted continuation for the Kármán values that seemed to best fit the particular case.

Kármán made a special study of the effect of eccentric loading in column testing. It should be noted that the unit stresses he found are those from tests on 0.50 per cent carbon steel. The important feature is that a small eccentricity has the greatest effect in reducing the maximum unit load for values of slenderness ratio from 80 to 85 for round end columns ($f = 1.0$), and this is probably true for the milder steel in these angles. For other degrees of end fixation the critical slenderness ratio is obtained by multiplying, say, the value 85 by the value of f . It will be seen in the detailed discussion that the average value of the maximum unit load falls below the Kármán-Euler curves for these slenderness ratios, thus denoting the presence of eccentricity.

Since the lateral deflection at mid height of the columns was measured during the tests, it is possible to obtain a rough comparative measure at least of the eccentricity of the test specimens. For a column with fixed ends there can be no effective eccentric loading. The load, no matter how far its point of application is from the centroidal axis of the column, can only produce such stresses in a fixed end specimen as would be produced by a load concentrically applied. The reason for this is that the definition of a "fixed end" column presupposes that the tangent to the elastic curve at one end is parallel to and remains parallel to the tangent at the other end. In a testing machine, if the columns were really to have fixed ends, the bearing plates would remain

parallel to each other throughout the test, and all effects of the eccentric loading would be taken up by the supporting screws of the testing machine. As a matter of fact, however, it is impossible to maintain this theoretical condition of fixed ends under an eccentric load either in a testing machine or in a built-up structure, and the column strength will be reduced if the load is applied eccentrically.

From the elastic theory one may express the relation between the lateral deflection at mid height, y_m , and the initial eccentricity, y_a , for round end columns, as follows:

$$y_m = y_a \left(\frac{I}{\cos \frac{l}{2r} \sqrt{\frac{P^1}{aE}} - 1} \right)$$

where P^1 is the load which produced the deflection y_m . Now, there is some value of $P^1 = kP$ (P being the value of the maximum load from Euler's formula) for which the lateral deflection y_m is equal to the initial eccentricity y_a . Solving for k under this condition, $k = 4/9$. That is, in a perfectly elastic round end column of any slenderness ratio the deflection at mid height when the load is $4/9$ of the theoretical maximum is equal to the initial eccentricity of load. For other degrees of end fixation this ratio would be different, but for the sake of comparison Tables 9 to 12 show the lateral deflection at mid height which occurred at the unit loads $S^1 = 4/9 S$. It is assumed that the value of the theoretical unit load S is given by the dash-and-dot curves of Figures 16 and 17. Any other definite ratio might have been chosen for the comparison, provided the ratio were small enough, but the comparative results would have been practically the same. No claim is made that these values represent the actual initial eccentricity. It is, however, evident that in practically all cases the specimen of given slenderness ratio and degree of end fixation which sustained the highest unit load also suffered the least lateral deflection at the unit load S^1 , while the specimen which suffered the greatest lateral deflection sustained the least unit load. Tables 9 to 12 also give the "rank" of the specimens according to strength and to lateral deflection. With very few exceptions the rank of a specimen is practically the same by either method of ranking.

One might conclude, then, from these results that the theoretical load-slenderness ratio curve for zero eccentricity should be drawn somewhat above the largest load values, and thus obtain a different value of fixation factor from the value obtained by considering the mean of the test results. It must, however, be pointed out

that the specimens closely represented the conditions in actual construction, and no better centering of a member would be obtained on the average than was obtained in these tests. The mean results are therefore of more importance in design than any such theoretically determined values would be.

(b) DETAILED DISCUSSION OF RESULTS.—Figure 16 shows the results of tests of angles with square ends. The average result line is close to the fixed end curve (dotted), but agrees still better with the dash-and-dot curve plotted for $f = 1.9$. At $l/r = 200$ the average result is below the curve, and it is in this region that the most marked effects of eccentric loading are to be expected.

When the angles were tested with one bolt connection—in one leg only, approximately round end columns,—the results are close to the curve of end fixation, for $f = 1.1$. No appreciable effect of eccentricity in loading in reducing the maximum load appears here in the average results because the slenderness ratio is so much greater than 85.

The results of tests of angles with folded ends, do not fall so close to the curve for $f = 1.1$ as did those just considered. So few specimens of this class were tested that it is impossible to draw any definite conclusion whether this type of column curve is suitable for angles with ends folded. It must also be noted that angles with ends folded, as shown in Figures 3, 6, and 8, have a variable radius of gyration from section to section. The ordinary column formulas are not derived for such conditions.

Figure 16 shows also the results of the tests of specimens held at each end with two bolts, in one leg only. This manner of fastening is more rigid than when a single bolt is used and the results for the columns with slenderness ratio as large as 200 lie close to the Euler curve for $f = 1.3$. For shorter columns the average results lie below this curve, and this may be due to the eccentric loading which would have the greatest effect at $l/r = 110$.

When two bolts are used, one in each leg, the degree of end fixation appears to be the same as for the previously considered class, and the results fall very close to the Euler curve for $f = 1.3$. The lengths tested in these two classes overlap for the slenderness ratios 200 and 250, and the average results for each of these slenderness ratios are nearly equal. The strength of the angles held with two bolts, in one leg only, is apparently the same as for specimens held with two bolts, one in each leg.

When two or more bolts were used in each leg for fastening the angle to the testing machine, the end fixation factor is still

larger, and the curve for $f=1.5$ of the Kármán-Euler type represents the average results very well, as shown in Figures 16 and 17. Here, again, the eccentricity lowers the average result value at the critical slenderness ratio value, $85 \times 1.5 = 127.5$, and is visible at $l/r = 150$. When angles are held as rigidly as these were, it might have been expected that the end fixation factor would have been closer to the fixed end condition, $f=2.0$. It may be that the factor is no higher than 1.5 because of the deformation which doubtless occurred in the structural members to which the test pieces were bolted.

IV. CONCLUSIONS.

1. The values of the maximum unit load in these tests vary over a considerable range for any given slenderness ratio and manner of fastening the angles in the testing machine.

2. In most cases the specimen which sustained the greatest unit load for a given slenderness ratio and method of fastening suffered the least lateral deflection and the angle which bent most sustained the lowest unit load at failure, the deflection being measured at $4/9$ of the theoretical maximum load.

3. For large slenderness ratios the average values are well represented by Euler's formula for long columns, calculated for different values of the end fixation factor.

4. The Kármán curves, recalculated for a yield point of 37,000 lbs./in.² and modulus of elasticity of 30,000,000 lbs./in.² represent the average results for small slenderness ratios for several methods of end fixation, except in the neighborhood of $l/r = 80$ to 85, where the effect of eccentricity was greatest. The values of the end fixation factor are given in Table 13.

5. For angles with ends folded the column formulas considered do not represent the results found in this series of tests.

6. It is believed that these values of end fixation factor are of importance in the design of structures where the end conditions approximate those used in these tests, no matter what formula the designer prefers to use.

7. Eccentricity of loading produces a diminution of column strength. In these tests the greatest effect of eccentricity was observed in the neighborhood of a "free length" corresponding to $l/r = 85$, which agrees with the results of Kármán's investigations.

WASHINGTON, April 12, 1922.



